


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment: Corner established in 1881 by Frank W. Campbell, under Contract No. 380

Surveyor General Record States:

79.90 intersect 1st std. Parallel 7.20 East of corner to Secs. 34 and 35 set a pine post for C.C. from which:

- A Pine 10 in. in diam. brs. N. 26° W. 23 lks Dist.
- A Pine 30 in. in diam. brs. S. 24° W. 139 lks. Dist.
- A Fir 30 in. in diam. brs. S. 20° E. 69 lks. Dist.

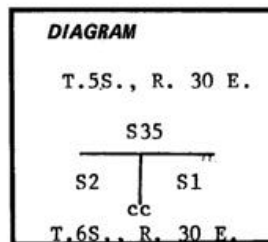

No record of subsequent remonumentation found in County Records.
Description of corner evidence found:

I did not find the original corner post. I establish this corner at record bearing and distance from the 3 original bearing trees as follows:

from the corner point:

- The remains of a 10" pine stump bears N. 26° W. 15.2 feet scribing visible
- A 36" Pine snag bears S. 24° W. 91.7 ft. mkd. R. 30 E., S. 2CC, BT
- A. 32" Fir stump bears S. 20° E. 45.5 ft. mkd. T6S. CC BT

Description of monument and accessories I established to perpetuate the original location of this corner:

At the corner point: Set a 2½"x30" galvanized iron pipe 20" in the ground with brass cap marked as shown. From which I scribe NEW BEARING TREES:

- A 10" Fir bears S. 59° E. 45.5 ft. mkd. T6S R30E S1 CC BT.
- An 18" Fir bears S. 53° W. 56.5 ft. mkd. T6S R30E S2 CC BT.


I nailed a brass washed marked "OPLS 598" to the BT blaze of both trees. Set a steel fence post 5 ft. E. of corner. Corner is 5 ft. South of E-W fenceline. Raised mound of stone, 3 ft. base to top of pipe. Used compass with 20° E. Variation and steel tape measuring to center of New BTs.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Robert D. Bagett

OREGON
JULY 12, 1963
ROBERT D. BAGETT
598

Sept. 30, 1976

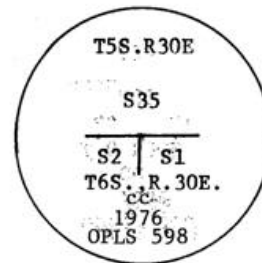

Office of..... County Surveyor..... County of..... Umatilla
Oregon
State of....., I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....
..... by
(COUNTY OFFICIAL) (DEPUTY)

A21

S-60-M