

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

E-7

History of original corner establishment: Corner established in 1881 by Frank W. Campbell, under Contract No. 380

Surveyor General Record States:

80.00 set a pine post for cor. to secs. 4, 5, 8, 9 from which:

- A pine 11 in. in diam. brs. N. 69° E. 15 lks. dist.
A pine 8 in. in diam. brs. N. 80° W. 47 lks. dist.
A pine 8 in. in diam. brs. S. 18° W. 45 lks. dist.
A pine 8 in. in diam. brs. S. 57° E. 39 lks. dist.

No record of subsequent remonumentation found in County Records.

Description of corner evidence found:

I did not find the original corner post. I establish the corner at record distance from the original bearing trees. From the corner point:


- A 21" pine bears N. 69° E. 9.9 ft. mkd. R30E T6S 4.
A 13" pine bears N. 80° W. 31.0 ft. with completely healed blaze.
A 12" pine dead and down brs. S. 17° W. 30.0 ft. with scribing visible in partially healed blaze.
A stump hole bears S. 62° E. 25.7 ft. no remains of BT.

Description of monument and accessories established to perpetuate the original location of this corner:

At the corner point: Set a 2 1/2"x30" galvanized iron pipe 24" in the ground with brass cap mkd as shown. From which I scribe 2 NEW BEARING TREES:

- A 6" fir bears S. 70° E. 26.4 ft. mkd. T6S R30E S9 BT.
An 18" fir bears S. 31° W. 56.5 ft. mkd. T6S R30E S8 BT.


I nailed a brass washer mkd "OPLS 598" to the BT blaze of both trees. Set a steel fence post 5 ft. East of corner. Corner is about 400 feet South of old logging road. Used a compass with 20° E. variation and steel tape, measuring to center of all BTs.

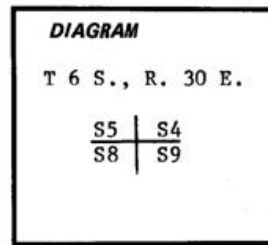

REGISTERED PROFESSIONAL LAND SURVEYOR

Robert D. Bagett (handwritten signature)

OREGON JULY 12, 1963 ROBERT D. BAGETT 598

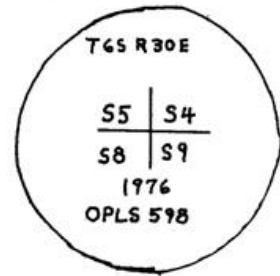

Sept. 30, 1976

Office of... County Surveyor... County of... Umatilla... State of... Oregon... I hereby certify that the within instrument was filed in this office for record on the... day of... 19... (COUNTY OFFICIAL) by (DEPUTY)

E-9

S-60-M