

USDA-FOREST SERVICE

Index

File No. R-5

CORNER RECORD (SEARCH)

(Ref. FSM 7151.4)

Tract or


Survey No. _____

Cor.

No. _____

T 6S R. 33ER.D. N.F. JOHN DAY County UMATILLAMerid. WILLAMETTEN.F. UMATILLA State OREGON

CORNER DIAGRAM

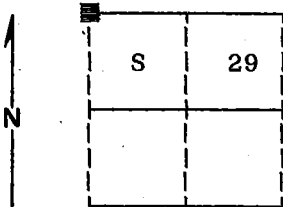

DESCRIBE CORNER MONUMENT FOUND

Found the remains of a wood post 6" below the ground

2

DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND

Found 14" Ponderosa Pine N44°E, 25.1 feet,
dead and down with scribes visible.
Found a faint stump hole S58°E, approximately 13 feet.
Found a 26" Fir S66°W, 23.6 feet live and vigorous with
blaze evident.
Found a 10" Ponderosa Pine N80°W, approximately 7 feet,
dead and down, loose on the ground, with scribes visible.

3

DESCRIBE CORNER LOCATION RELATIVE TO NEAR-BY FEATURES, ALSO HOW TO REACH CORNER

Corner falls on steep North hillside approximately 100 feet
North of a clearcut.

PHOTO IDENTIFICATION DATA

Photo No. 280-228Filed At. Ranger OfficeObject Ident. CornerIdent. By D. I. Griffith*Signature*

7

PLANE COORDINATE POSITION DATA

State _____ Zone _____

X _____

Y _____

Estab. By _____

*Agency**Signature*

8

Title

Division

Headquarters

Date

8-1-87

FS-7100-52 (3/68)

4

5

CORNER RECORD (PERPETUATION)

MONUMENT: DESCRIBE NEW MONUMENT SET, OR WORK DONE TO PRESERVE EXISTING MONUMENT

Set a 2½"x30" aluminum pipe with cap marked as shown;
Pipe is set 30 inches in the ground.

T6S	R33E
S 19	S 20
S 30	S 29
1987	
OPLS 644	

ACCESSORIES : DESCRIBE NEW BT's WITNESS OBJECTS ETC. ESTABLISHED, OR WORK DONE TO PRESERVE EXISTING EVIDENCE

New BTs:

A Douglas Fir 23" diam. bears N65°E, 15.58 feet marked T6S R33E S20 BT

A White Fir 7" diam. bears S38°E, 36.94 feet marked S29 BT

A White Fir 8" diam. bears N38°W, 23.81 feet marked X BT

Painted a 6 inch red band around all bearing trees and attached 54-3 and 54-9 signs.
Set a steel fencepost approximately 5 feet North with 54-9 sign attached.

Work Done By D.I. Griffith Title Surveyor Date 7-11-87 State Registration No. OPLS 644
or Agency

Certified Cor. Record Prepared? Yes No Filed At: Umatilla Co. Survey Office Date 8-86

REMARKS

Index File No. R-5 T. 6S R. 33E WM. Tract or Surv. No. Cor.

USDA-FOREST SERVICE

Index
File No. R-5
T 6S R. 33E
Merid. Will

CORNER RECORD (SEARCH)


(Ref. FSM 7151.4)

Tract or Survey No. _____ Cor. No. _____

R.D. NORTH FORK JOHN DAY County UMATILLA
N.F. UMATILLA State OREGON

CORNER DIAGRAM

T6S R33E

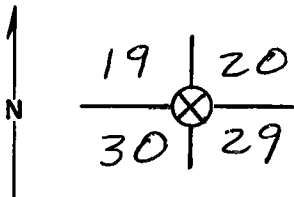

DESCRIBE CORNER MONUMENT FOUND

NONE

DESCRIBE BEARING TREES OR OTHER OFFICIAL ACCESSORIES FOUND

ORIG. 10" FIR IS LIVE WITH DOUBLE HEALED BLAZES. NOW 22". BEARS S68°W, 21.1 FT.
ORIG. 8" PINE IS DOWN. FULL SCRIBES VISIBLE ON DOUBLE BLAZES, BEARS N80°W, 7.3 FT.
ORIG. 12" PINE IS DOWN. FULL SCRIBES VISIBLE ON DOUBLE BLAZES, BEARS N44°E, 25.1 FT.

DESCRIBE CORNER LOCATION RELATIVE TO NEAR-BY FEATURES, ALSO HOW TO REACH CORNER

ORIG. 8" TAMARACK IS JUST A MOUND OF DECAYED WOOD.
CORNER IS JUST NORTH OF RIDGE TOP IN AN UNCUT AREA.
I PUT A LOCATION POSTER ON A 14" FIR N60°E, 12 FT. FROM CORNER.

PHOTO IDENTIFICATION DATA

Photo No. _____
Filed At. _____
Object Ident. _____
Ident. By _____
Signature _____

PLANE COORDINATE POSITION DATA

State _____ Zone _____
X _____
Y _____
Estab. By _____
Agency _____

Signature Dennis S. Layford Title PLS Division 1636 Headquarters S.O. Date 7-24-86
FS-7100-52 (3/68)

CORNER RECORD (PERPETUATION)

MONUMENT: DESCRIBE NEW MONUMENT SET, OR WORK DONE TO PRESERVE EXISTING MONUMENT

9

ACCESSORIES : DESCRIBE NEW BT'S WITNESS OBJECTS ETC. ESTABLISHED, OR WORK DONE TO PRESERVE EXISTING EVIDENCE

10

Work Done By _____ **Title** _____ **Date** _____ **State Registration No.**
or Agency _____

Certified Cor. Record Prepared ? Yes No **Filed At:** _____ **Date** _____ **11**

REMARKS

12

Index File No. **T.** **R.** **M.** **Tract or Surv. No.** **Cor.** **13**